



**i** An arrow on the protective cap shows the wind direction in which the instrument was calibrated and the best readings obtained.

## Commissioning

Remove the protective film on the display.

## Switching on

Press button once



Segmenttest



Current reading

## Changing the parameters

Press button repeatedly:



Velocity



Temperature



Volume

Set duct cross-section  $m^2$

✓ Keep On button pressed when switching on. 1st position flashes.

1 Keep On button pressed until desired digit appears.

Wait 2 seconds and the digit will apply. The cursor then changes to the next position.

2 Repeat the described procedure for all positions.

## Switching off

Keep button pressed for 3 seconds.

## Technical data

Type of application: ..... Short measurement  
Measuring range m/s: ..... 0 to 5 m/s at -20 to 0 °C;  
0 to 10 m/s at 0 to +50 °C

Measuring range m3/h: ..... 0 to 99900 m3/h

Measuring range °C: ..... -20 to +50 °C

Resolution: ..... 0.01 m/s; 0.1 °C

Accuracy: (system accuracy at calibration temp. +25 °C)  
±(0.1 m/s + 5 % of m.v.) (to 2 m/s);  
±(0.3 m/s + 5% of m.v.) (over 2 m/s)  
± 0.5 °C

Ambient temperature: ..... 0 to +50 °C

Storage temperature: ..... -20 to +70 °C

Battery type: ..... 3 x AAA

Battery lifetime: ..... Approx. 20 h  
(approx. 750 measurements lasting 2 minutes each)

Probe stem: ..... Ø 0.5 in/Ø 0.6 in / Length:  
5.9 to 11.8 in

Warranty: ..... 2 years

CE guideline ..... 2004/108/EEC

## Please read before using instrument

- Observe flow direction
- Adhere to sensor measuring ranges
- Do not exceed maximum storage and operating temperatures (e.g. protect measuring instrument from direct sunlight!)
- Inexpert handling cancels your warranty.

## Changing the battery



The battery has to be changed if the symbol appears in the display during the measurement.

✓ Instrument is switched off.

1 Open battery compartment cover.

2 Remove spent batteries and insert new batteries (3x AAA) into the battery compartment. Observe polarity!

3 Close battery compartment cover.

## Auto Off function

If no button has been pressed in approx. 5 minutes, the instrument switches itself off automatically.



**■** Une flèche sur le capot de protection indique le sens des flux pour lequel l'appareil de mesure a été étalonné, et qui permet d'obtenir les meilleurs résultats.

### Mise en service

Retirez le film de protection de l'afficheur.

### Mise en route

**On** Touche 1. Après impulsion: test écran:



Test écran



Valeur actuelle

### Changement de grandeurs

**On** Appuyez plusieurs fois sur ON.



Vitesse



Température



Débit

### **On** Réglage des sections de gaine m<sup>2</sup>

✓ Lors de l'allumage, maintenir la touche ON enfoncee. La position paramétrable clignote sur l'écran.

1 Maintenir la touche ON enfoncee jusqu'à ce que le chiffre désiré s'affiche. Patienter pendant 2 s = la valeur paramétrée est appliquée et le curseur passe à la position suivante.

2 Répéter la procédure décrite pour toutes les positions.

### Arrêt

**On** Appuyer 3 secondes en continu.

### Caractéristiques techniques

|   |   |
|---|---|
| Type d'application :                      | .....Mesure courte durée  |
| Etendue de mes. m/s: .....                | 0...5 m/s à -20...0 °C;<br>0...10 m/s à 0...+50 °C  |
| Etendue de mes. m <sup>3</sup> /h: .....  | 0...99990 m <sup>3</sup> /h   |
| Etendue de mes. °C: .....                 | -20...+50 °C  |
| Résolution: .....                         | 0,01 m/s, 0,1 °C  |
| Precision: (Précision du système à +25°C) |   |
|   | ±(0,1 m/s + 5 % v.m) (jusqu'à 2 m/s);<br>±(0,3 m/s + 5% v. m) (au dessus de 2 m/s)<br>±0,5 °C |
| Température d'utilisation: .....          | .....+50 °C   |
| Température de stockage: .....            | -20...+70 °C  |
| Pile: .....                               | Pile bouton 3 x AAA   |
| Autonomie: .....                          | environ 20 h<br>(env. 750 mesures en 2 min)   |
| Dimensions sondes: .....                  | Ø 12 mm/16 mm / longueur:<br>150...300 mm   |
| Garantie: .....                           | 2 ans   |
| Directive européenne .....                | 2004/108/CEE  |

### A lire avant mise en route !

- Observer le sens du flux!
- Respecter l'étendue de mesure du capteur!
- Ne pas dépasser les températures de stockage et d'utilisation!
- Un dépassement des consignes d'utilisation risque d'entraîner l'affichage de valeurs erronées!

### Remplacement de la pile



Si le signal apparaît pendant la mesure, les piles doivent être changées.

✓ L'appareil est éteint.

- 1 Retirer le couvercle du compartiment pile
- 2 Retirer les piles vides / accus déchargés et insérer des piles neuves / accus rechargés (3x AAA) dans le compartiment pile.  
Attention à la polarité !
- 3 Fermer le couvercle du compartiment pile.

### Fonction Auto-Off

**Off** Arrêt automatique environ 5 minutes sans manipulation.

0973.4053/03/Sh/wh/08.01.2008